
UNIVERSITI SAINS MALAYSIA

First Semester Examination
Academic Session 2004/2005

October 2004

ZAE 282E/3 - Material Science
[Sains Bahan]

Duration : 3 hours
[Masa : 3 jam]

Please check that this examination paper consists of **SEVEN** pages of printed material before you begin the examination.

*[Sila pastikan bahawa kertas peperiksaan ini mengandungi **TUJUH** muka surat yang bercetak sebelum anda memulakan peperiksaan ini.]*

Instructions: Answer all **FIVE** (5) questions. Students are allowed to answer all questions in Bahasa Malaysia or in English.

Arahan: Jawab kesemua **LIMA** (5) soalan. Pelajar dibenarkan menjawab semua soalan sama ada dalam Bahasa Malaysia atau Bahasa Inggeris.]

1. (a) Compare Face Centered Cubic (FCC) crystal structure to Body Centered Cubic (BCC) crystal structure.
[(a) Bandingkan struktur hablur Kubus Berpusat Muka (FCC) kepada struktur hablur Kubus Berpusat Jasad (BCC).]
(20/100)
- (b) (i) Show that the atomic packing factor for BCC is 0.68
[(i) Tunjukkan bahawa faktor padatan atom untuk BCC ialah 0.68.]
(ii) Calculate the radius of an iridium (Ir) atom, given that Ir has a FCC crystal structure, a density of 22.4 g/cm^3 and an atomic weight of 192.2 g/mol.
[(ii) Kira jejari atom Iridium (Ir), apabila Ir mempunyai struktur hablur FCC, ketumpatan sebanyak 22.4 g/cm^3 dan berat atom sebanyak 192.2 g/mol.]
(30/100)
- (c) Explain the formation of grain boundaries.
[(c) Jelaskan pembentukan sempadan-sempadan butiran]
(20/100)
- (d) (i) What is the composition, in atomic percent, of an alloy that consists of 92.5 wt% Ag and 7.5 wt% Cu?
 Atomic weight: Cu = 63.55 g/mol; Ag = 107.87 g/mol.
*[(i) Apakah komposisi, dalam peratus atom, suatu aloi yang mengandungi 92.5 wt% Ag dan 7.5 wt% Cu?
 Berat atom: Cu = 63.55 g/mol; Ag = 107.87 g/mol.]*
(ii) What is the composition, in weight percent, of an alloy that consists of 5 at% Cu and 95 at% Pt?
 Atomic weight: Cu = 63.55 g/mol; Pt = 195.08 g/mol.
*[(ii) Apakah komposisi, dalam peratus berat, suatu aloi yang mengandungi 5 at% Cu dan 95 at% Pt?
 Berat atom: Cu = 63.55 g/mol; Pt = 195.08 g/mol.]*
(30/100)

2. (a) Give a brief explanation of diffusion flux.
[Berikan penjelasan ringkas tentang fluks serapan]

(25/100)

A Tabulation of Diffusion Data

<i>Diffusing Species</i>	<i>Host Metal</i>	$D_0(m^2/s)$	<i>Activation Energy Q_d</i>		<i>Calculated Values</i>	
			<i>kJ/mol</i>	<i>eV/atom</i>	<i>T(°C)</i>	$D(m^2/s)$
Fe	α -Fe (BCC)	2.8×10^{-4}	251	2.60	500	3.0×10^{-21}
					900	1.8×10^{-15}
Fe	γ -Fe (FCC)	5.0×10^{-5}	284	2.94	900	1.1×10^{-17}
					1100	7.8×10^{-16}
C	α -Fe	6.2×10^{-7}	80	0.83	500	2.4×10^{-12}
					900	1.7×10^{-10}
C	γ -Fe	2.3×10^{-5}	148	1.53	900	5.9×10^{-12}
					1100	5.3×10^{-11}
Cu	Cu	7.8×10^{-5}	211	2.19	500	4.2×10^{-19}
Zn	Cu	2.4×10^{-5}	189	1.96	500	4.0×10^{-18}
Al	Al	2.3×10^{-4}	144	1.49	500	4.2×10^{-14}
Cu	Al	6.5×10^{-5}	136	1.41	500	4.1×10^{-14}
Mg	Al	1.2×10^{-4}	131	1.35	500	1.9×10^{-13}
Cu	Ni	2.7×10^{-5}	256	2.65	500	1.3×10^{-22}

Table 1

- (b) Referring to table 1, (gas constant = 8.31 J/mol -K)
[(b) Merujuk kepada Jadual 1, (pemalar gas = 8.31 J/mol -K)]
- (i) Compute the value of the diffusion coefficient for the diffusion of zinc in copper at 650°C.
[(i) Kira nilai koefisien serapan untuk serapan zink dalam kuprum pada 650 °C.]
- (ii) At what temperature will the diffusion coefficient for the diffusion of copper in nickel have a value of $6.5 \times 10^{-17} m^2/s$?
[(ii) Pada suhu berapakah koefisien serapan untuk serapan kuprum dalam nikel akan mempunyai nilai $6.5 \times 10^{-17} m^2/s$?]
- (iii) Compute the values of the diffusion coefficients for the diffusion of carbon in both α -iron (BCC) and γ -iron (FCC) at 900°C. Which is larger and explain why this is the case?
[(iii) Kira nilai-nilai koefisien serapan untuk serapan karbon dalam kedua-dua α -besi (BCC) and γ -besi (FCC) pada 900 °C. Yang manakah lebih besar dan jelaskan mengapa terjadi begitu?]

(25/100)

- (c) (i) Give a brief explanation on plastic deformation.
Berikan penerangan ringkas tentang canggaan plastik.]
- (ii) Describe the phenomenon of elastic recovery using a stress-strain plot.
Jelaskan fenomena pemulihan elastik menggunakan plot tegasan-terikan.]

(25/100)

- (d) (i) What is the driving force for recrystallization and for grain growth?
Apakah kuasa yang menggalakkan penghabluran semula dan penumbuhan butiran.]
- (ii) Give an explanation on grain growth.
Berikan penjelasan tentang penumbuhan butiran.]

(25/100)

3. (a) Explain briefly the equilibrium and metastable states.
Berikan penjelasan ringkas tentang kedaan keseimbangan dan metastabil.]

(25/100)

- (b) (i) Cite the difference between eutectic, eutectoid and peritectic reactions.
Berikan perbezaan antara tindakbalas-tindakbalas eutektik, eutektoid dan peritektik.]
- (ii) What is the difference between terminal solid solution and intermediate solid solution phases.
Apakah perbezaan antara fasa-fasa larutan pepejal terminal dan larutan pepejal pertengahan.]
- (iii) Distinguish between hypoeutectoid and hypereutectoid steel microstructures.
Bezakan antara mikrostruktur-mikrostruktur hipoeutektoid dan hipereutektoid.]

(25/100)

- (c) Briefly describe the following phases in Fe-Fe₃C phase diagram:
Berikan penerangan ringkas fasa-fasa berikut yang terdapat dalam gambarajah fasa Fe-Fe₃C.]
- (i) Ferrite
(ii) Austenite
(iii) δ-ferrite
(iv) Fe₃C

(20/100)

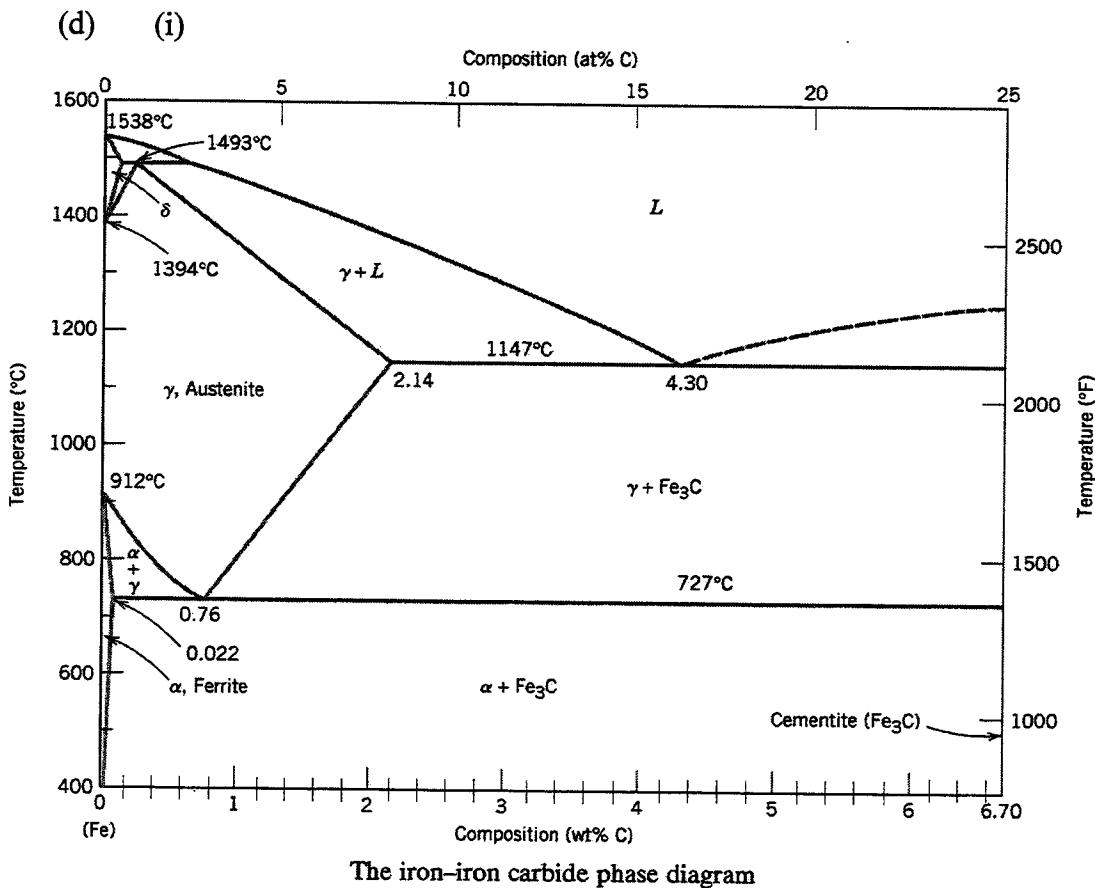


Figure 1

Referring to Figure 1, for a 99.65 wt% Fe – 0.35 wt% C alloy at a temperature just below the eutectoid, determine the following:

[Merujuk kepada Rajah 1, untuk aloi for a 99.65 wt% Fe – 0.35 wt% C pada suhu betul-betul di bawah eutektoid, tentukan yang berikut:]

- (a) The fractions of total ferrite and cementite phases.
[(a) Pecahan fasa-fasa penuh ferit dan simentit.]
- (b) The fractions of the proeutectoid ferrite and pearlite.
[(b) Pecahan ferit proeutektoid dan pearlit.]
- (c) The fraction of eutectoid ferrite.
[(c) Pecahan ferit eutektoid.]

(30/100)

4. (a) (i) Cite and briefly explain the three categories of phase transformation.
[(i) Berikan dan terangkan dengan ringkas tiga kategori transformasi fasa.]
- (ii) Name the two stages involved in the process of phase transformation. Briefly describe them.
[(ii) Namakan dua peringkat yang terlibat dalam proses transformasi fasa. Terangkan dengan ringkas kedua-duanya.]
- (iii) Briefly describe the phenomena of superheating and supercooling.
[(iii) Terangkan dengan ringkas fenomena superpemanasan dan superpenyejukan.]
- (20/100)
- (b) (i) Explain the formation of pearlite microstructure.
[(i) Jelaskan pembentukan mikrostruktur pearlit.]
- (ii) Briefly explain why fine pearlite is harder and stronger than coarse pearlite.
[(ii) Terangkan dengan ringkas mengapa pearlit halus adalah lebih keras dan kuat berbanding pearlit kasar.]
- (iii) Cite two major differences between pearlitic and martensitic transformation.
[(iii) Berikan dua perbezaan utama antara transformasi pearlit dan martensit.]
- (iv) Briefly cite the differences between pearlite, bainite and spheroidite relative to microstructure and mechanical properties.
[(iv) Berikan dengan ringkas perbezaan-perbezaan antara pearlit, bainit dan sferoidit berhubung kepada ciri-ciri mikrostruktur dan mekanikal.]
- (50/100)
- (c) (i) Cite the purposes and the stages of annealing.
[(i) Berikan tujuan-tujuan dan peringkat-peringkat sepuhlindap.]
- (ii) Explain the influence of quenching medium, specimen size and geometry on hardenability.
[(ii) Jelaskan pengaruh medium penyejukan, saiz dan geometri spesimen ke atas kebolehkerasan.]
- (iii) Draw a typical hardenability curve and explain.
[(iii) Lukiskan kurva kebolehkerasan yang tipikal dan jelaskan.]
- (30/100)

5. (a) (i) Explain Schottky defect in ceramics.
[(i) *Jelaskan kecacatan Schottky dalam seramik.*] (30/100)
- (ii) Explain why slip is very difficult in crystalline ceramics?
[(ii) *Jelaskan mengapa gelincir adalah sukar dalam seramik berhablur.*] (30/100)
- (b) Give an explanation on the existence of impurities in ceramics.
[(b) *Berikan penjelasan tentang kewujudan bendasing dalam seramik.*] (25/100)
- (c) (i) What is the distinction between glass transition temperature and melting temperature?
[(i) *Apakah perbezaan antara suhu peralihan kaca dan suhu lebur?*] (25/100)
- (ii) Discuss the heat treatment of glasses.
[(ii) *Bincangkan rawatan haba untuk kaca.*] (25/100)
- (iii) State and briefly describe the specific points that are important in the fabrication and processing of glasses.
[(iii) *Nyatakan dan jelaskan dengan ringkas titik-titik spesifik yang penting dalam fabrikasi dan pemerosesan kaca.*] (45/100)